


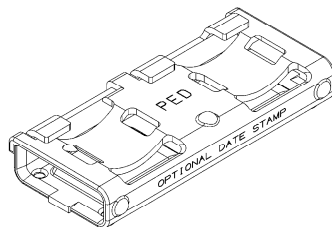
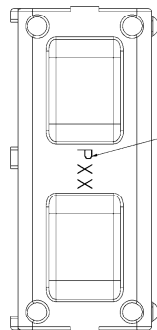


	MISSING SYMBOL
	NO MISSING SYMBOL NUMBER

ONE						TWO						THREE					
DATE	SYS	REV	APP	CHK	DWG	REVISION HISTORY						AUTH	DR	APPROVED	DATE		
11NOV99	R	01	-	-	-	CLEARED REVISION COLUMN, ADDED COLUMN CLARIFYING ADDITIONAL REQUIREMENTS FOR ALL PARTS, CREATED PART DRAWING.						195669	TLM	TL	BL		
11NOV99	R	02	-	-	-	RELEASED 15JAN98/04.						990005	TLM	TL	BL		
30MAY01	R	03	-	-	-	ALL PARTS - REVISED MAT'L SPEC						287923	J5	J5	B0		
07OCT04	R	04	-	-	-	15JAN98/04 - OBSOLETE						254510	J5	J5	B0		
12AUG05	R	05	-	-	-	REVISED NOTE 6 & INSPECTION SYMBOLS						362026	HFS	ND	B0		
14JUL15	R	06	-	-	-	ADDED "BATCH 1 OF 2"						430196	JAN	JAN	B0		

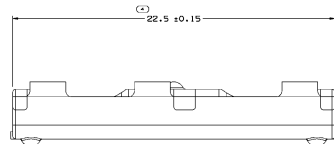

TYPE 101



— SEE NOTE #12

1. UNLESS OTHERWISE SPECIFIED AND/OR INDICATED

1. DIMENSIONS ARE TO FACE OF VIEW SHOWN AND AUTOMATICALLY ROUNDED BY COMPUTER FOR INSPECTION (USE MATH MODEL FOR PRECISE DIMENSIONS). FOR ALL OTHER DIMENSIONS NOT SHOWN BUT REQUIRED FOR TOOL BUILD, SEE MATH MODEL FOR PRECISE TOOL PATH DATA.
2. RECOMMENDED MATING BLADE 0.810 +0.035 THICK X 8.00 +0.15 WIDE.
3. MAXIMUM CURRENT CAPACITY IS 80 AMP.
4. *▲* INDICATES AFTER CUT-OFF DIMENSION.
5. MATERIAL SPECIFICATION: TIN PLATING WITH A THICKNESS OF 0.0026 - 0.0079 MM.
6. AFTER TERMINAL MAKE, PRE-PLATED TERMINALS MUST BE AIR DRY OR PRESSURE WATER WASHED. ALL SOLDER, SOLDER FLUX, SILVERERS AND OTHER CONTAMINATION, WASH SOLUTION, TO BE WATER ONLY. HOT AIR DRY IS REQUIRED TO REMOVE EXCESS MOISTURE. THE AIR SUPPLY IS TO BE CLEAN AND OIL FREE. THE WASHING PROCESS AND THE DRYING PROCESS ARE TO BE HANDLED SUCH THAT THE WASHING PROCESS DOES NOT DAMAGE THE INTEGRITY OF THE PRODUCT.
7. EXCESS MOISTURE AND/OR LUBRICANT NOT ALLOWED.
8. FOR TYPE 102 ONLY:
 - A. SPRINGS ARE TO BE MADE OF NON-CONDUCTIVE MATERIAL (DELPHIN-PACKARD CR18 41501810 OR EQUIVALENT).
 - B. CONTINUOUS TERMINALS ON REELS MUST HAVE PAPER INTERLEAF.
9. *ALL DIMENSIONS SHOWN ARE TO BE 100% INSPECTED UTILIZING A CAMERA VIEW SYSTEM. LOOSE PIECE PARTS MUST BE VERIFIED.
10. SCORE DEPTHS NOT TO EXCEED 0.18 MM.
11. STAMPED CHARACTERS CANNOT EXTEND ONTO ANY RADII.
12. "XXXX" INDICATES "PP" PLUS LAST TWO DIGITS OF MAKE DIE (SERIES NUMBER 100, 102, 103, ETC)

12162525	O1	AB	101	LOOSE PEECE	YES
12162525	A5	-	102	REELED	YES
12092089	H7	-	101	LOOSE PEECE	NO
PART NO	REV	N/P	TYPE	COMMENTS PER NOTE #8	VISION INSPECTED PER NOTE #9

1. THE TERMS "FIXTURE" & "FURNITURE" ARE NOT AVAILABLE FOR SPECIFICATIONS. 2. PART NAMES SHOULD NOT BE USED AS A LINE NUMBER. INDICATE THE NUMBER OF THE PART. PARTS ARE AVAILABLE FOR SPECIFICATION. 3. CONTACT DEALER! SALES TO ASSURE AVAILABILITY	
PART DRAWING	
NAME ALL LINE HEAVY	STUDY CASE 
UNLESS OTHERWISE SPECIFIED THIS DRAWING IS IN ACCORDANCE WITH ANSI Y14.5-1994 ALL DIMENSIONS ARE IN INCHES. DIMENSIONS IN PARENTHESES ARE IN MILLIMETERS.	
1/8" = 1" 1/4" = 1" 1/2" = 1" 3/4" = 1" 1" = 1"	ALL DIMENSIONS ARE IN MILLIMETERS
THIRD ANGLE PROJECTION 	DO NOT SCALE  USE WITH DATA

[illegible]